
W Union elbow

EO 24° cone end

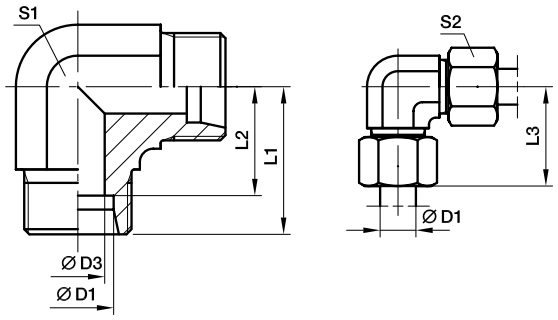

Series	D1	D3	L1	L2	L3	S1	S2	Weight g/1 piece	Order code*	PN (bar)[1] CF	71	MS
LL[2])	04	3.0	15	11.0	21	9	10	13	**W04LL**	100	100	63
	06	4.5	15	9.5	21	9	12	15	**W06LL**	100	100	63
	08	6.0	17	11.5	23	12	14	23	**W08LL**	100	100	63
	10	8.0	18	12.5	24	12	17	32	**W10LL**	100	100	63
	12	10.0	19	13.0	25	14	19	41	**W12LL**	100	100	63
L[3])	06	4.0	19	12.0	27	12	14	29	**W06L**	500	315	200
	08	6.0	21	14.0	29	12	17	43	**W08L**	500	315	200
	10	8.0	22	15.0	30	14	19	54	**W10L**	500	315	200
	12	10.0	24	17.0	32	19	22	80	**W12L**	400	315	200
	15	12.0	28	21.0	36	19	27	81	**W15L**	400	315	200
	18	15.0	31	23.5	40	24	32	140	**W18L**	400	315	200
	22	19.0	35	27.5	44	27	36	178	**W22L**	250	160	100
	28	24.0	38	30.5	47	36	41	340	**W28L**	250	160	100
	35	30.0	45	34.5	56	41	50	458	**W35L**	250	160	100
	42	36.0	51	40.0	63	50	60	776	**W42L**	250	160	100
S[4])	06	4.0	23	16.0	31	12	17	52	**W06S**	800	630	400
	08	5.0	24	17.0	32	14	19	74	**W08S**	800	630	400
	10	7.0	25	17.5	34	19	22	97	**W10S**	800	630	400
	12	8.0	29	21.5	38	17	24	137	**W12S**	630	630	400
	14	10.0	30	22.0	40	19	27	145	**W14S**	630	630	400
	16	12.0	33	24.5	43	24	30	162	**W16S**	630	400	250
	20	16.0	37	26.5	48	27	36	221	**W20S**	420	400	250
	25	20.0	42	30.0	54	36	46	424	**W25S**	420	400	250
	30	25.0	49	35.5	62	41	50	603	**W30S**	420	400	250
	38	32.0	57	41.0	72	50	60	1010	**W38S**	420	315	200

[1]) Pressure shown = item deliverable

[2]) LL = very light series; [3]) L = light series; [4]) S = heavy series

$\frac{\text{PN (bar)}}{10}$ = PN (MPa)

Delivery without nut and ring. Information on ordering complete fittings see page I7.

*Please add the **suffixes** below according to the material/surface required.

Order code suffixes		
Material	Suffix surface and material	Example
Steel, zinc plated, Cr(VI)-free	CFX	W16SCFX
Stainless Steel	71X	W16S71X
Brass	MSX	W16SMSX

Tel: +45 63 12 83 00 | Email: ps@hymatik.com | www.hymatik.com | Hvidkaervej 27a, DK-5250 Odense SV, Denmark